

VEGAMET 342

Controller for two continuously measuring analogue level sensors



Application area

The controller VEGAMET 342 feeds the connected 4 ... 20 mA sensors, processes the measured values and displays them. The built-in housing is ideal for mounting in the switching cabinet. A large display for data visualisation as well as a turn/push button for easy adjustment on site are integrated.

It enables simple implementation of pump controls, flow measurements on open channels and weirs, totalizers, difference, sum and average value calculations. With VEGAMET 342, limit values can be reliably monitored and relays can be switched, e.g. for an overflow protection according to WHG.

Due to its various possibilities it is suitable for many industrial branches as well as plant manufacturers.

Your benefit

- Easy-to-read display from a distance, even in sunlight and darkness
- Complex programming of control tasks is no longer necessary
- Simple and reliable commissioning and diagnosis of the measuring points via smartphone

Function

The VEGAMET 342 controller can power the connected sensors and process their measurement signals. The requested parameter is shown on the display and also output to the integrated current output for further processing. The measurement signal can thus be transferred to a remote display or a superordinate control system. Operating relays for control of pumps or other devices are also integrated.

Approvals

Worldwide approvals are available for VEGA instruments, e.g. for use in hazardous areas, on ships or in hygienic applications.

The technical data in the respective safety instructions are valid for approved instruments (e.g. with Ex approval). In some cases, these data can differ from the data listed herein.

You can find detailed information on the existing approvals with the appropriate product on our homepage.

Technical data

Operating voltage	
– Nominal voltage AC	100 ... 230 V (-15 %, +10 %) 50/60 Hz
– Nominal voltage DC	24 ... 65 V (-15 %, +10 %)
Power consumption	max. 15 VA; 5 W

Sensor input

Number of sensors	2 x 4 ... 20 mA
Type of input (selectable)	
– Active input	Sensor supply through VEGAMET 342
– Passive input	Sensor has an own voltage supply

Measured value transmission

– 4 ... 20 mA	analogue for 4 ... 20 mA sensors
---------------	----------------------------------

Deviation

– Accuracy	±20 µA (0.1 % of 20 mA)
------------	-------------------------

Relay output

Quantity	3 x operating relay, one can be configured as fail safe relay
Contact	Floating change-over contact (SPDT)
Switching voltage	max. 250 V AC/60 V DC
Switching current	max. 1 A AC (cos phi > 0.9), 1 A DC
Breaking capacity	min. 50 mW, max. 250 VA, max. 40 W DC (with U < 40 V DC)

Current output

Quantity	2 x output
Range	0/4 ... 20 mA, 20 ... 0/4 mA
Max. load	500 Ω

Bluetooth interface

Bluetooth standard	Bluetooth 5.0
--------------------	---------------

Indicators

Measured value indication	
– Graphic-capable LC display, with lighting	70 x 45 mm, digital and quasianalogue display
Adjustment elements	Turn/Push button

Ambient conditions

Ambient temperature	
– Instrument in general	-20 ... +60 °C (-4 ... +140 °F)

Electrical protective measures

Protection rating	
– Front	IP40 (IEC 60529)
– Instrument	IP20 (IEC 60529)

Adjustment

The VEGAMET 342 has an integrated display and adjustment unit. In addition, the parameter adjustment of the device can be done via Bluetooth and corresponding adjustment tools.

Adjustment via the display and adjustment unit

The adjustment is carried out menu-driven via a turn/push button and a clearly arranged, graphic-capable display with backlight.

Wireless adjustment via Bluetooth


The integrated Bluetooth module enables wireless connection to smartphones/tablets (iOS/Android) or Windows PCs.

Operation is via a free app from the "Apple App Store", the "Google Play Store" or the "Baidu Store". Alternatively, adjustment can also be carried out via PACTware/DTM and a Windows PC.



Wireless connection to smartphone/tablet/notebook

Electrical connection

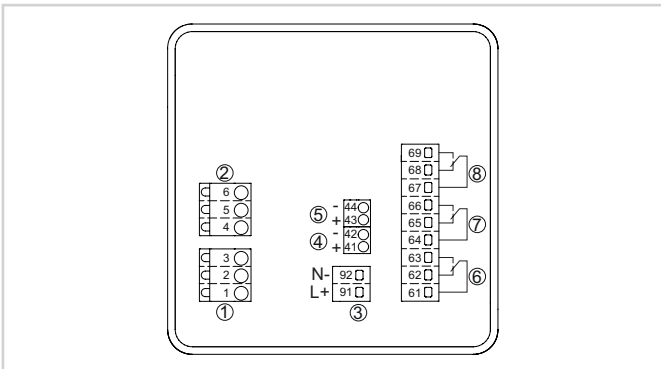


Wiring plan VEGAMET 342

- 1 Sensor input 1 (active/passive)
- 2 Sensor input 2 (active/passive)
- 3 Voltage supply of the controller
- 4 4 ... 20 mA current output 1
- 5 4 ... 20 mA current output 2
- 6 Relay output 1
- 7 Relay output 2
- 8 Relay output 3

Details on the electrical connection can be found in the operating instructions of the device in the download area on our homepage.

Dimensions

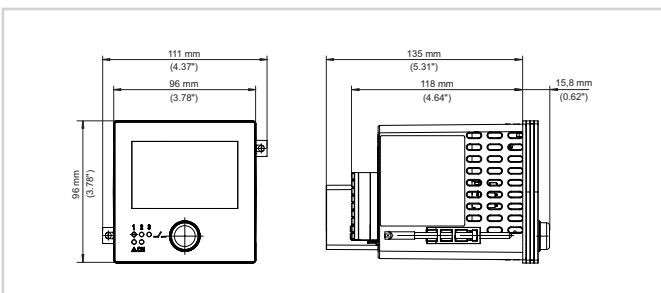

Information

You can find further information on the VEGA product line on our homepage.

In the download section of our homepage you'll find operating instructions, product information, industry brochures and approval documents as well as device and adjustment software.

Contact

You can find your personal contact person at VEGA on our homepage under "Contact".